

Classification:
Reference:
Date:

EC07-013

ITB08-011

February 22, 2008

2008 G37; RELAY BOX UPPER COVER REPLACEMENT

APPLIED VEHICLE: 2008 G37 (CV36)
APPLIED DATE: Vehicles built before August 31, 2007
APPLIED VIN: Vehicles built before JNKCV64E(*)8M106604

SERVICE INFORMATION

If you are diagnosing issues related to the VVEL system or power to the radiator fans, be advised the relay cover is incorrectly labeled as shown in Figure 1. Refer to Figure 2 for the correct relay cover.

NOTE: Remove and replace the relay box upper cover shown in Figure 1 with the relay box upper cover listed in the Parts Information section of this bulletin and displayed in Figure 2.


Old Relay Cover



TP070846

Figure 1

New Relay Cover

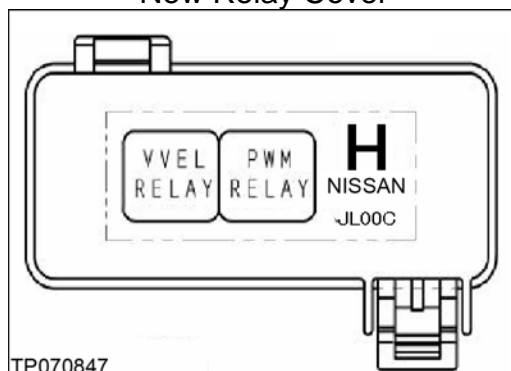

TP070847

Figure 2

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Remove the battery cover. See Figure 3.
2. Remove 5 clips (A) located on the hood lid cover (B). See Figure 4.
3. Remove the hood lid cover.



Figure 3

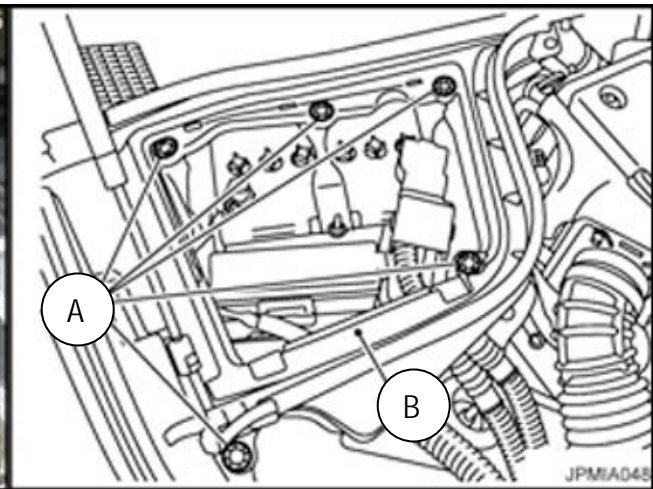


Figure 4

4. Refer to Figures 5 and 6 to locate the relay box upper cover.

Relay box upper cover



Figure 5



Figure 6

5. Remove and replace the relay box upper cover.
6. Re-install the hood lid, clips, and battery cover in reverse order of removal.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Relay Box Upper Cover	24382-JL00C	1

CLAIMS INFORMATION

Submit a Primary Failed Part (PP) line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL Relay Box Upper Cover	(1)	RX74AA	ZX	03	0.2 hrs

(1) Reference the Parts Information Table and use the applicable Relay Box Upper Cover P/N as the PFP.

