

Classification:
EL10-022a

Reference:
ITB10-027a

COPYRIGHT© NISSAN NORTH AMERICA, INC.
Date:
June 29, 2010

XENON HEAD LAMP SERVICE

This bulletin has been amended. The Parts Information has been updated.
Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2005 – 2011 Infiniti with xenon headlamps

IF YOU CONFIRM

A xenon headlamp is not functioning because of an issue inside the headlamp assembly (an internal issue),

ACTION

Refer to the appropriate Service Manual, follow the diagnostic and repair information for xenon headlamps.

NOTE:

- In most cases, replacement of a bulb or HID control unit will solve the incident.
- **Do not replace the entire xenon headlamp assembly when a bulb or HID control unit is available to solve the incident, if one should occur.**

CLAIMS INFORMATION

- Reference the current Nissan Flat Rate Manual and use the appropriate claims coding for the repair performed.
- For HID control unit replacement use Operation Code RJ36AA.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

PARTS INFORMATION

Description	Model	Year	Part Number (P/N)	QTY	
HID Control Unit (Includes Starter)	G35 Sedan (V35)	2005 – 2006	28474-8992A	1 per side as needed	
	G35 Sedan (V36)	2007 - 2008			
	G37 Sedan (V36)	2009 - 2010			
	G35 Coupe (CV35)	2005 - 2007			
	G37 Coupe (CV36)	2008 - 2010			
	M35/45 (Y50)	2006 - 2010			
	FX35/50 (S51)	2009 - 2010	28474-8991B		
	FX35/45 (S50)	2003 - 2008			
	QX56 (JA60)	2004 - 2010			
	QX56 (Z62)	2011			
	EX35 (J50)	2008 - 2010			
	M37/56 (Y51)	2011	28474-8992B		
Xenon Headlamp Bulb	G35 Sedan (V35)	2005 – 2006	26297-9B91A	1 per side as needed	
	G35 Sedan (V36)	2007 - 2008			
	G37 Sedan (V36)	2009 - 2010			
	G37 Coupe (CV36)	2008 - 2010			
	M35/45 (Y50)	2006 - 2010			
	EX35 (J50)	2008 - 2010			
	FX35/50 (S51)	2009 - 2010	26297-89902		
	FX35/45 (S50)	2003 - 2008			
	G35 Coupe (CV35)	2005 - 2007			
	M37/56 (Y51)	2011			26297-89903
	QX56 (JA60)	2004 - 2010			26297-9B90A
	QX56 (Z62)	2011			26297-89900

NOTE:

- The HID control unit includes a starter (xenon bulb socket). For some models, the starter is not replaceable. In this case, replace only the HID control unit using the old starter.
- Torque specification for the screw that holds the starter to the HID control unit is:
1.3 – 1.7 N•m (0.13 – 0.17 k-gm, 12 – 15 in-lb)

