

Classification:
BT10-037

Reference:
ITB10-069

Date:
November 5, 2010

G37 CONVERTIBLE; HEADLINING SERVICE INFORMATION

APPLIED VEHICLE: 2009 – 2011 G37 Convertible (HV36)

SERVICE INFORMATION

Replacement headlinings for G37 Convertibles do not come with rear rib wire rods. When replacing a headlining for any reason, the wire rods need to be transferred from the original headlining.

When installing the wire rods, make sure they are properly secured to the rear rib. Improper installation may cause the headlining to sag at the "C" pillar, and / or cause damage to the headlining during convertible roof operation.

NOTE: There are two (2) wire rods, one at each end of the rear rib. The photo below shows its location on the left side.


- See Page 2 - 5 for further information.




The photos on the following pages show the location and removal / installation of the wire rods.




Headlining, removed

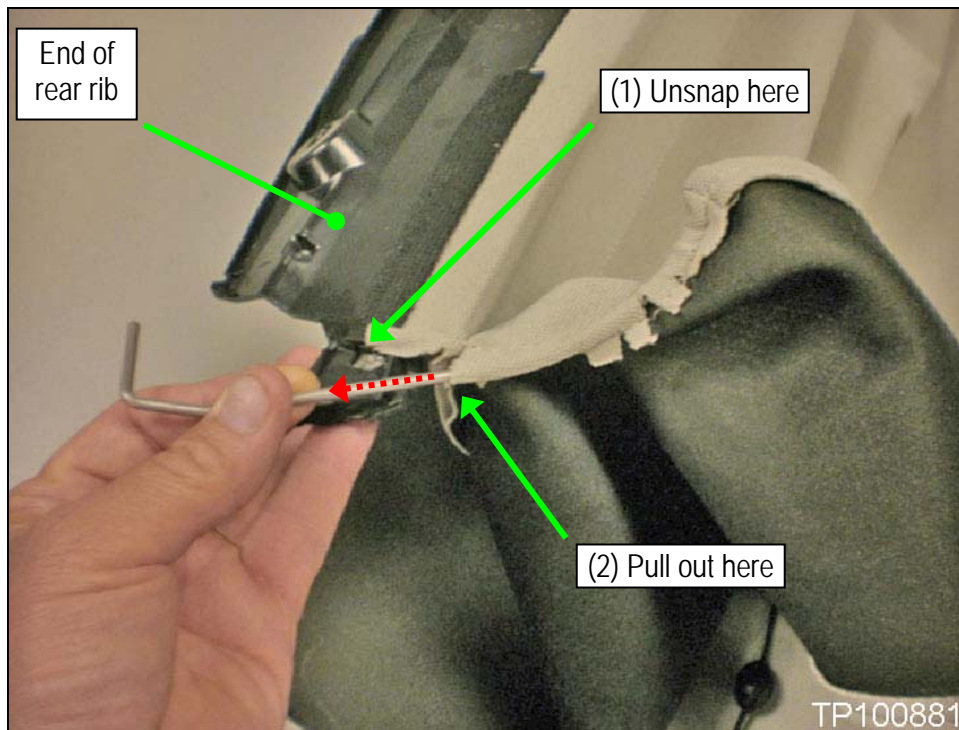


Remove wire rods from old headlining

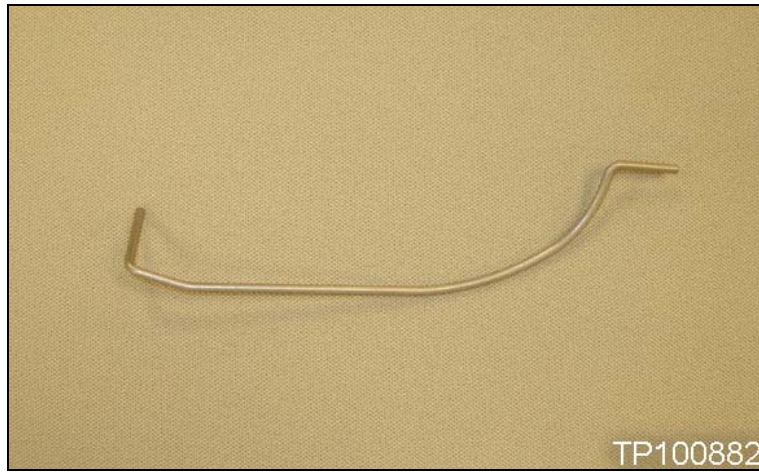

Wire Rod

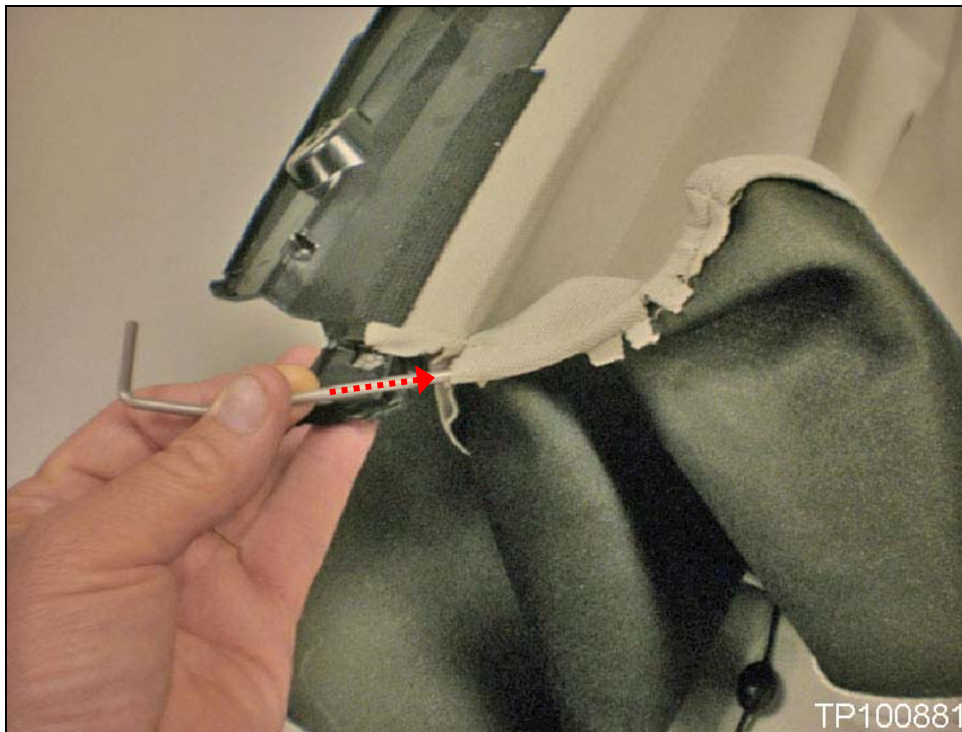

Carefully insert wire rods in new headlining

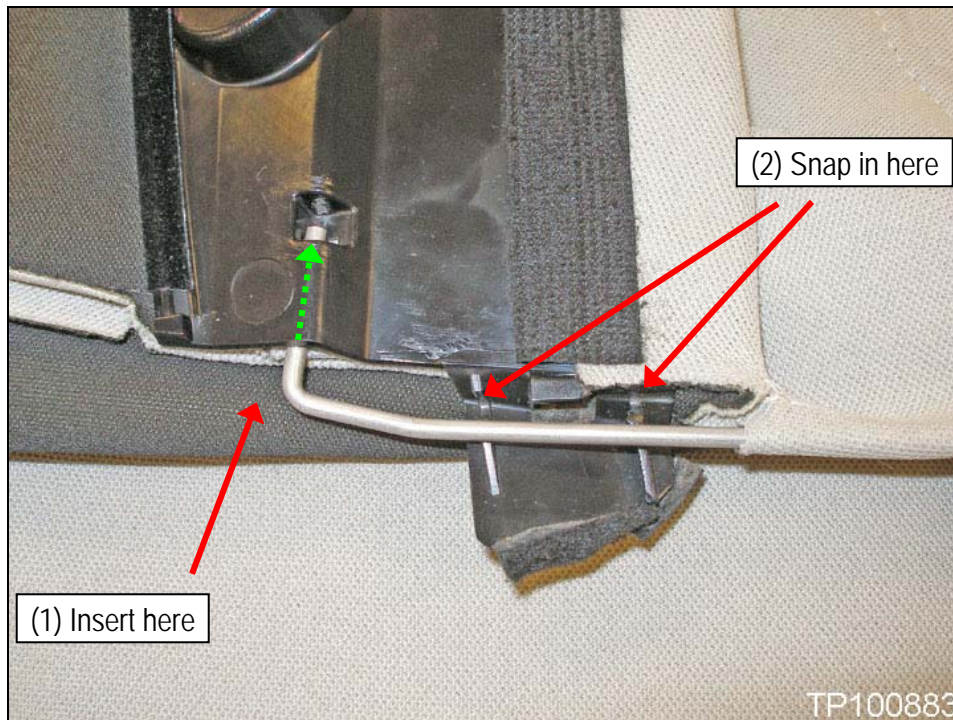

Fasten wire rods to rear rib



Wire rod properly installed



Wire rod improperly installed; headlining sags



Wire rod properly installed

