

Classification:

BR10-012

Reference:

ITB10-074

COPYRIGHT© NISSAN NORTH AMERICA, INC.

Date:

December 15, 2010

ABS / VDC CAN DIAGNOSIS INFORMATION

APPLIED VEHICLES: All 2005 – 2011 Infiniti vehicles with ABS and / or VDC

SERVICE INFORMATION

When diagnosing a vehicle with an ABS or VDC / SLIP warning light on with DTCs stored in the ABS / VDC actuator control unit, perform DTC diagnosis first.

- Do not replace the ABS / VDC actuator control unit without being supported by the DTC diagnosis.
- Do not erase DTCs before performing DTC diagnosis.
- Always fully diagnose before performing any repairs.

When DTC U1000 (CAN COMM CIRCUIT) is the only DTC stored in the ABS / VDC actuator control unit, use the **REPAIR FLOW CHART** starting on Page 2. This will assist in proper diagnosis results and repairs in addition to using diagnostic information in the Electronic Service Manual (ESM).

- If DTC U1000 is found stored in other systems, refer to NTB10-066 and the applicable ESM.
- If other DTCs are found stored in ABS / VDC along with U1000, follow the diagnosis steps for those DTCs in the applicable ESM.

CLAIMS INFORMATION

Refer to the current Infiniti Warranty Flat Rate Manual and use the appropriate claims coding for repairs performed.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

REPAIR FLOW CHART



