

Classification:

RS11-001

Reference:

ITB11-012

Date:

February 14, 2011

2009 – 2010 G37 CONVERTIBLE; PRE-TENSIONER SEAT BELT RETRACTOR SERVICE INFORMATION


APPLIED VEHICLE: 2009 – 2010 G37 Convertible (HV36)

SERVICE INFORMATION

Replacement pre-tensioner seat belt retractors for 2009 – 2010 G37 Convertibles have been revised. The re-designed “D” ring is raised with a taller bolt and collar. When replacing a pre-tensioner seat belt retractor for any reason, adjustments for additional clearance will need to be made to the related rear side finisher.

See below for differences between previous and revised “D” rings, bolts, and collars.

Go to Page 2 and 3 for rear side finisher adjustments.

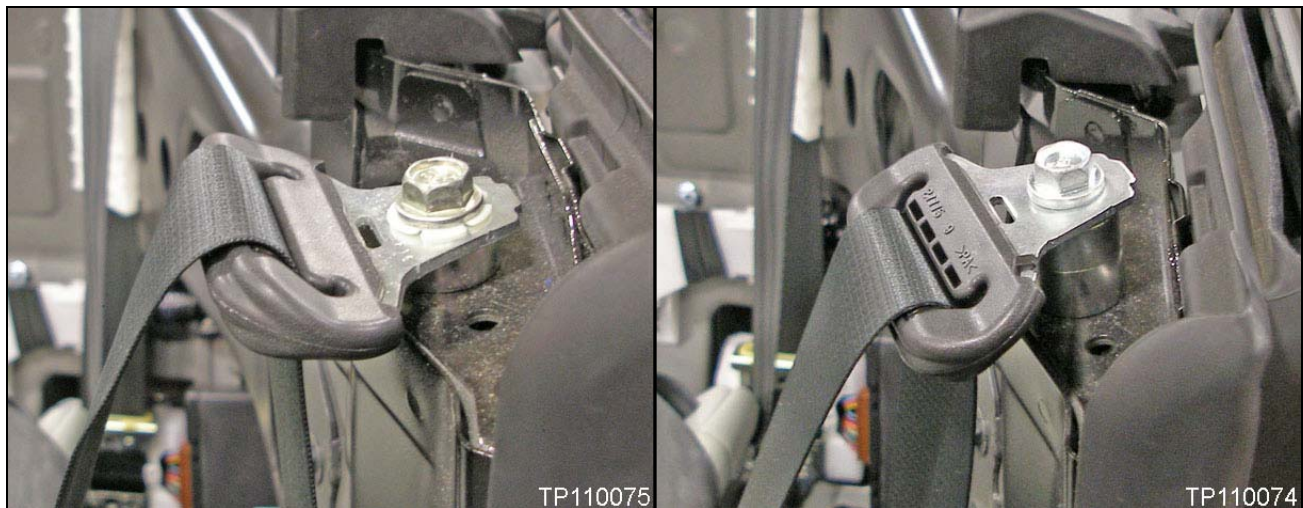

Old style.


New style.

CLAIMS INFORMATION


Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Repair Rear Side Finisher Rib Cut	(1)	VX3UAA	(2)	(2)	0.9


- (1) Refer to the electronic parts catalog (FAST or equivalent) and use the appropriate Seat Belt Assembly part number as the Primary Failed Part (PFP).
- (2) The Symptom and Diagnosis should be what you used which required the Assembly replacement.

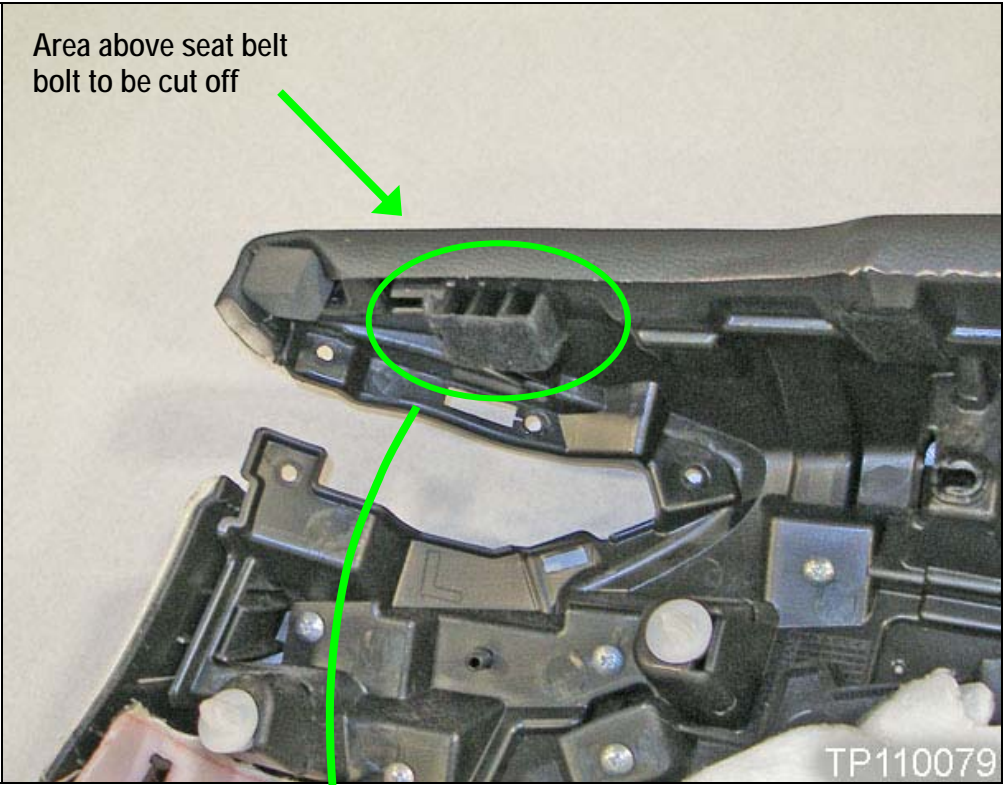


Rear side finisher.

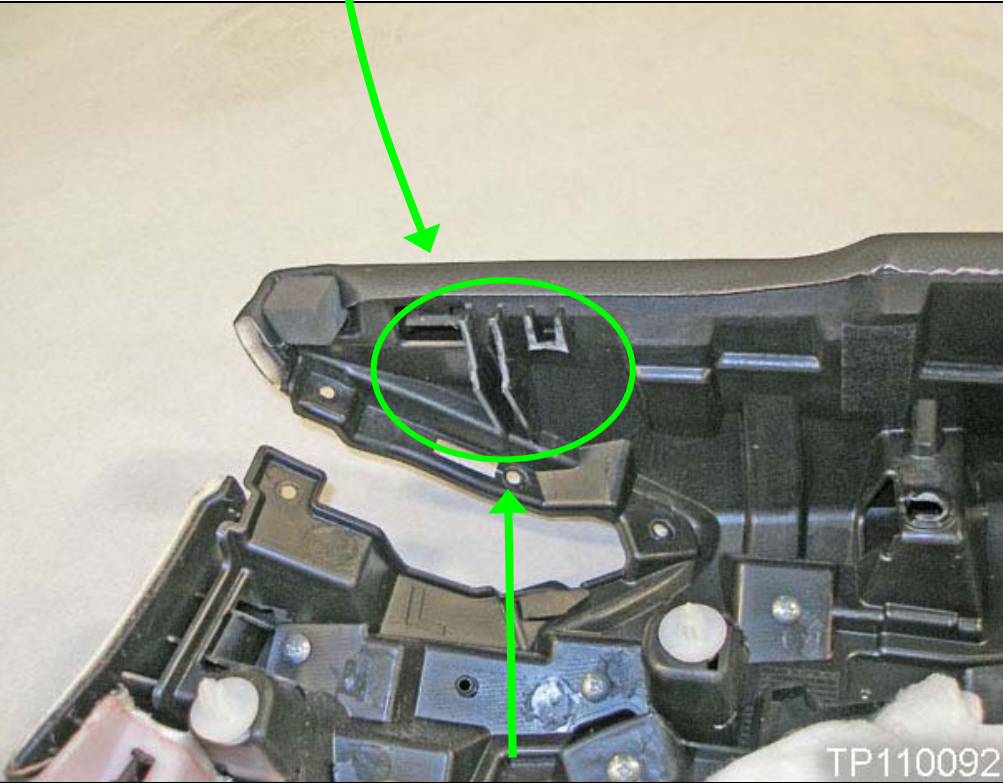

Location of cut area.

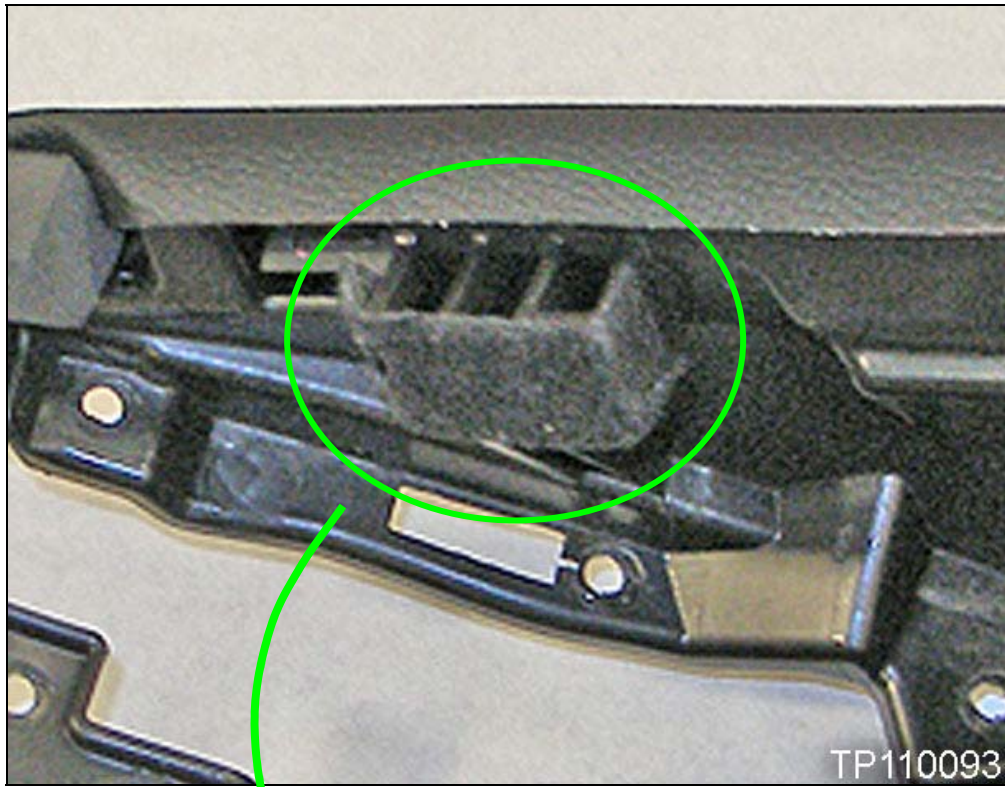

Close-up of area to be cut.

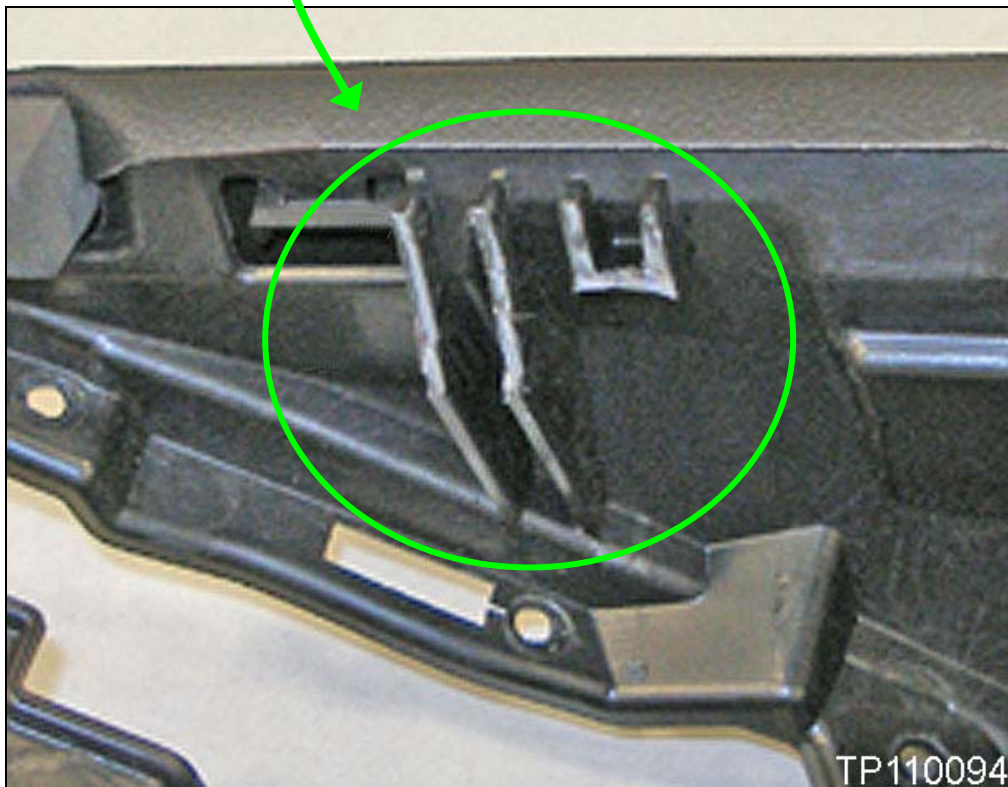

Close-up of cut area.

