

COPYRIGHT@ NISSAN NORTH AMERICA, INC. Classification: Reference:

BT11-011a ITB11-032a May 17, 2011

G37 CONVERTIBLE; HEADLINING CATCHING ON RETRACTABLE HARDTOP HINGE PIN

This bulletin has been amended. PARTS INFORMATION has been amended. Please discard previous copies.

APPLIED VEHICLE: 2010 and 2011 G37 Convertible (HV36)

APPLIED VINs and

DATES: Vehicles built starting with JNKCV6FE(*)AM 355150 and September 3, 2010 and

ending with JNKCV6FE(*)BM 950490 and November 9, 2010


IF YOU CONFIRM:

When closing the RHT (Retractable Hardtop), the headlining catches on one or both hinge pins (see below).

ACTION:

Replace <u>both</u> main tether cords listed in **PARTS INFORMATION** on Page 2.

- If the headlining is found damaged due to this incident, if it should occur, replace it.
- For main tether cord and headlining removal and installation, refer to the K>BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY>RF>ROOF section of the Electronic Service Manual (ESM), if needed.
- See Page 2 for additional information. This information must be applied in addition to the ESM repair procedure.

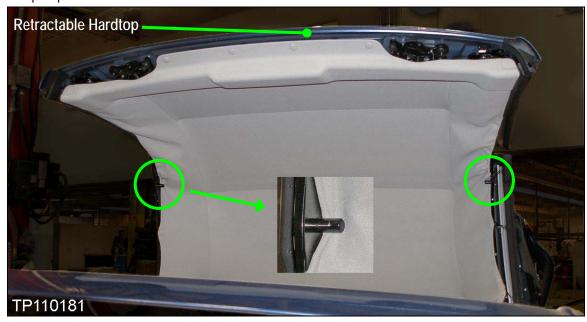

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
WIRE, RH (main tether cord)	97198-JJ51E	1
WIRE, LH (main tether cord)	97198-JJ52E	1
HEADLINING ASSY-FOLDING ROOF	97160-JJ50A	1 (if needed)

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding.


DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace both Main Tether Cords	97160-JJ50A	SX03AA	ZE	32	0.5


And on the same repair line only if headlining assembly is replaced

DESCRIPTION	OP CODE	FRT
Replace Headlining Assembly	SA57AA	(1)

(1) Reference the current Infiniti Warranty Flat Rate Manual and use the indicated flat rate time.

ADDITIONAL SERVICE INFORMATION

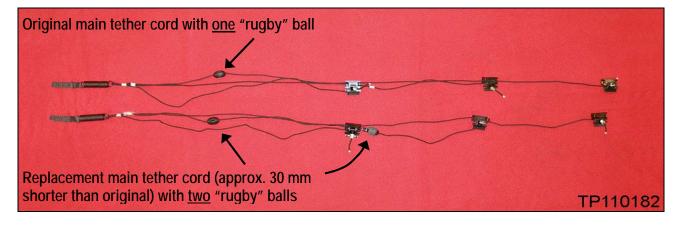

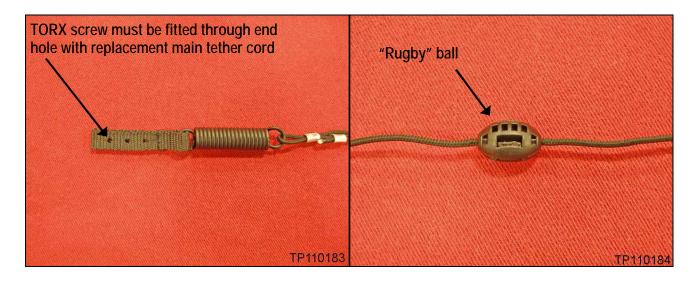

2/2 ITB11-032a