

Classification:

EC11-028

Reference:

ITB11-060

COPYRIGHT© NISSAN NORTH AMERICA, INC.

Date:

October 21, 2011

INTAKE AIR VOLUME LEARN WILL NOT COMPLETE

APPLIED VEHICLES:

All

APPLIED DATES:

2007 - 2012

SERVICE INFORMATION

If IAVL will not complete using CONSULT:

- a. While the engine is running, disconnect "Mass Air Flow" (MAF) sensor for 10-15 seconds until MIL (P0102 or P010C) comes on, and then reconnect **before** performing "Intake Air Volume Learn" (IAVL).
 - If vehicle has two MAF sensors, disconnect only **one** in prior step and leave the second one connected; then reconnect.
 - Engine may stop running when idle reduction occurs. Reconnect MAF sensor and continue to step "b".

NOTE: If P0102 or P010C were not stored when DTC was confirmed, repeat step "a" until idle is reduced.

- b. Clear any DTC's that may have set during MAF disconnect.
- c. Perform IAVL.
- d. Confirm that idle is now within specification for model and year of vehicle being worked on.

See Electronic Service Manual for procedure to set IAVL and for vehicle idle specifications.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.