

**Classification:**
**Reference:**
**Date:**

BT11-035b

ITB11-064b

January 25, 2012

## SQUEAK NOISE WHEN PRESSING ACCELERATOR PEDAL

This bulletin has been amended to include a parts information table only. No other changes have been made to the body of this bulletin.

**APPLIED VEHICLES:**

2007 - 2012 G37 Sedan (V36)  
 2008 - 2012 G37 Coupe (CV36)  
 2009 - 2012 G37 Convertible (HV36)  
 2011 - 2012 G25 Sedan (V36)  
 2008 - 2012 EX35 (J50)  
 2011 - 2012 M (Y51)

**IF YOU CONFIRM:**

The Accelerator Pedal squeaks when being pressed.

**ACTION:**

Apply urethane foam pad, from Squeak and Rattle Kit, between the upper Accelerator Pedal Bracket and the Accelerator Pedal Assembly.

- See steps on next page to apply foam.

**NOTE:** Refer to Electronic Service Manual (ESM) for procedure to remove and reinstall Accelerator Pedal Assembly, and for Accelerator Pedal Released Position Learning.

**PARTS INFORMATION**

DESCRIPTION	PART #	QUANTITY
Urethane Pad	76884-71L02	1

**CLAIMS INFORMATION**

Submit a Primary Part (PP) line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Install Foam on Accelerator Pedal Bracket	(1)	FX44AA	ZL	44	0.2

- (1) Refer to the electronic parts catalog (FAST or equivalent) and use the appropriate Accelerator Pedal Assembly part number as the primary part.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

Confirm that engine and ignition are off

1. Remove Accelerator Pedal Assembly.

- Figure 2 shown with Accelerator Pedal removed, and bracket circled in green.



Figure 1



Figure 2

➤ Pedal removed.

2. Attach piece of 1.5 by 2.0 inch foam, from "Squeak and Rattle Kit", to backside of Accelerator Assembly Bracket, with adhesive facing outward.

- 2.0" x 1.5" precut urethane foam. Part number (76884-71L02).



Figure 3

3. Figure 4 shows foam attached to backside of bracket.



Figure 4

4. Side view of foam attached to backside of bracket.



Figure 5

5. Fold foam over and stick to front side of bracket.



Figure 6

6. Re-install Accelerator Pedal over bracket with foam installed.



Figure 7

7. Refer to ESM for Accelerator Pedal Self Learn Procedure.
8. After installing Accelerator Pedal Assembly over foam, confirm that the squeak noise is gone.