

Classification:

RS11-005

Reference:

ITB12-002

Date:

January 9, 2012

SUPPLEMENTAL RESTRAINT SYSTEM (SRS) FRONT DOOR SIDE SATELLITE SENSOR INTRODUCTION

APPLIED VEHICLES: All 2011-2012 Infiniti vehicles with SRS DTC B1338 and/or B1345 logic

SERVICE INFORMATION

The Applied Vehicles now come equipped with a "Front Door Side Satellite Sensor", in addition to the pre-existing Side Air Bag Satellite Sensor found in the pillar.

These Sensors have new Diagnostic Trouble Codes (DTC) associated with them.


IMPORTANT: If the front door internals are being serviced for any reason, and this Sensor is unplugged or reconnected with the ignition ON, **the following codes could be stored:**

- B1338 and/or B1345 - SATELITE SENSOR LH or RH.

And

- The code(s) is a "PAST" code **only**.

NOTE: When diagnosing the DTCs listed above, be aware of this potential sequence of events.

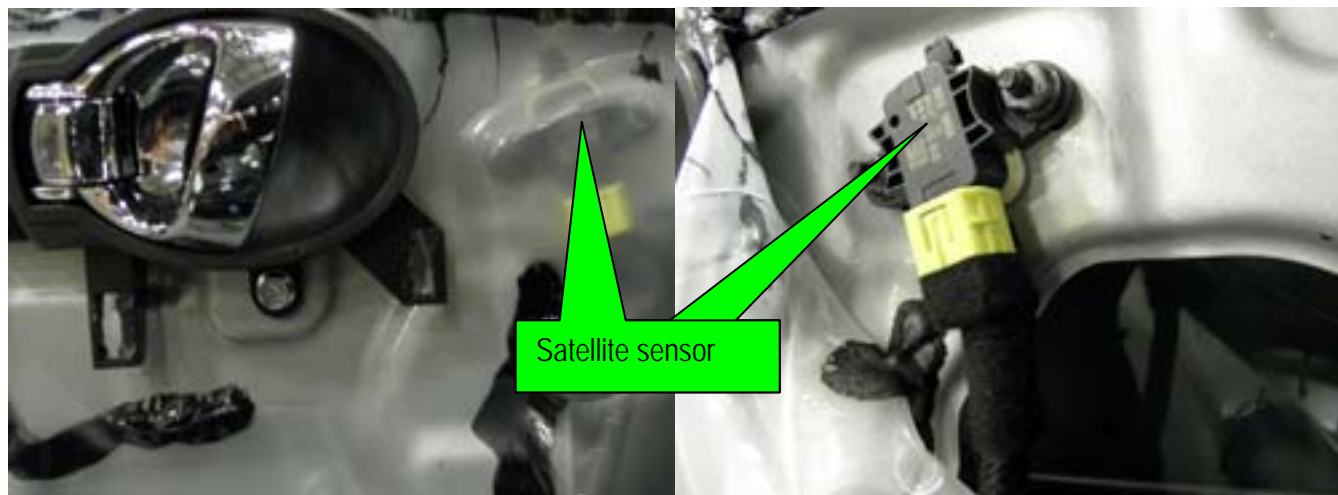

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.