

Classification:
EL09-036

Reference:
ITB09-061

COPYRIGHT© NISSAN NORTH AMERICA, INC.
Date:
November 5, 2009

POWER SOCKET REMOVER TOOL J-42059

APPLIED VEHICLES: 2004 and later Infiniti Vehicles

SERVICE INFORMATION

If the power socket needs to be removed or replaced for any reason:

- Refer to the **SERVICE PROCEDURE** section of this bulletin on Page 2.
- Use Power Socket Tool J-42059 (see Figure 1).
- This new special tool is considered "Essential" and will be shipped to each dealer by November 5, 2009. Your Non-Vehicle account will be charged \$16.95 plus applicable taxes and freight.

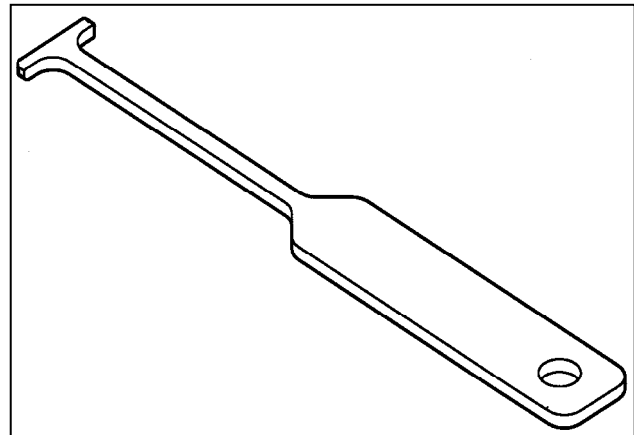


Figure 1

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

NOTE: If the tool does not fit because of the location of the particular socket, further disassembly of interior components may be required before its use.

1. Remove the fuse for the power socket.
 - For fuse number and its location, refer to the appropriate section of the Electronic Service Manual (ESM) as needed.
2. Insert one end of Tool J-42059 into one of the square holes inside the socket (see Figure 2).



Figure 2

3. Lift up the tool's handle until the other end inside the socket slides in and "snaps" into the other square hole (see Figure 3).
 - The second hole is on the opposite side of the first hole.



Figure 3

4. Pull the socket straight out with the tool (see Figure 4).



Figure 4

5. To install the socket, push in until it "snaps" into place.

- Make sure to align the tab with the notched area during installation as shown in Figure 5 and 6.

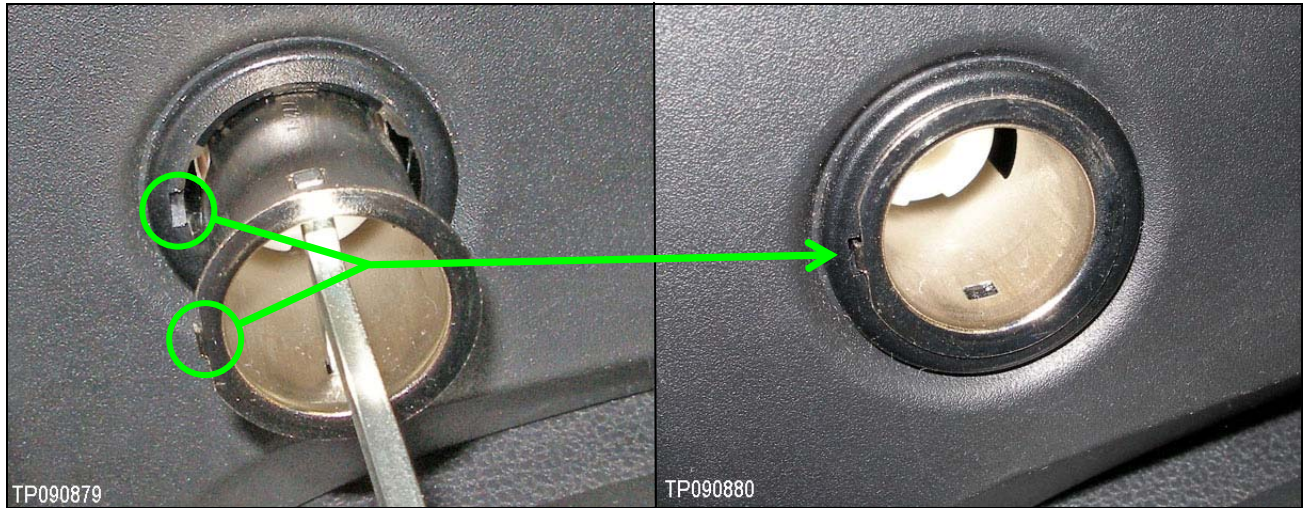


Figure 5

Figure 6

